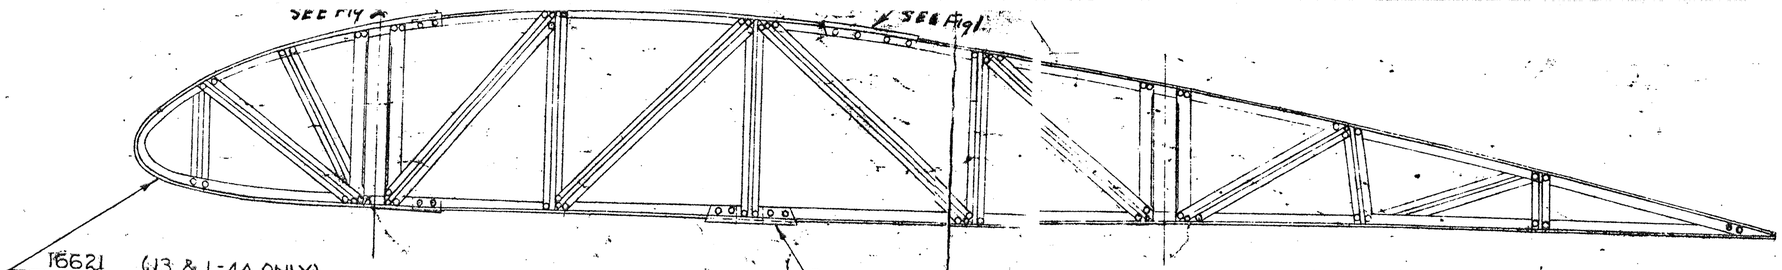

16621 (J3 & L-4A ONLY)
16661-2 (J4 & J5 WOOD SPAR WING ONLY)
16661-3 (J4 & J5C METAL SPAR WING ONLY)

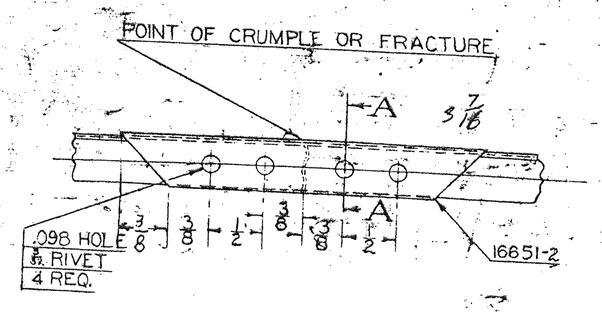

FIG. 1
FULL SIZE

NOTE: THIS REPAIR MAY BE USED AT ANY POINT ON CAPSTRIP EXCEPT AT CLUSTERS OR FORWARD OF FRONT SPAR.

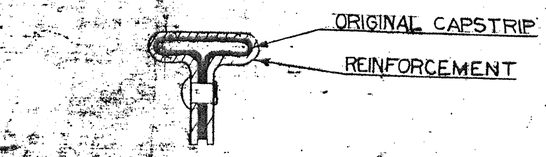

SECTION A-A
TWICE SIZE

NOTE: FORM REINFORCEMENT OVER CAPSTRIP AND RIVET TO WEB OF CAPSTRIP AS SHOWN.

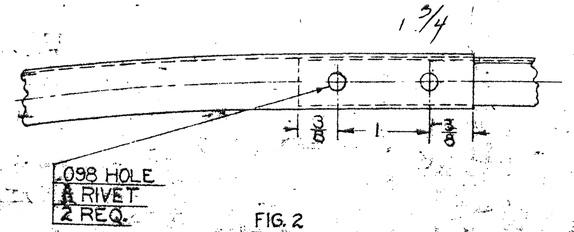

FIG. 2
FULL SIZE

NOTE: CAPSTRIP MAY BE SPLICED OR REINFORCED ANYWHERE EXCEPT FORWARD OF FRONT SPAR OR AT A CLUSTER.

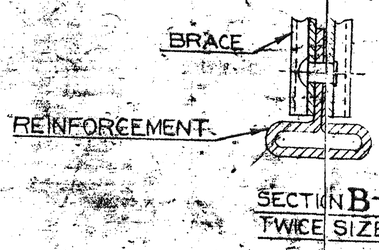

SECTION B-B
TWICE SIZE

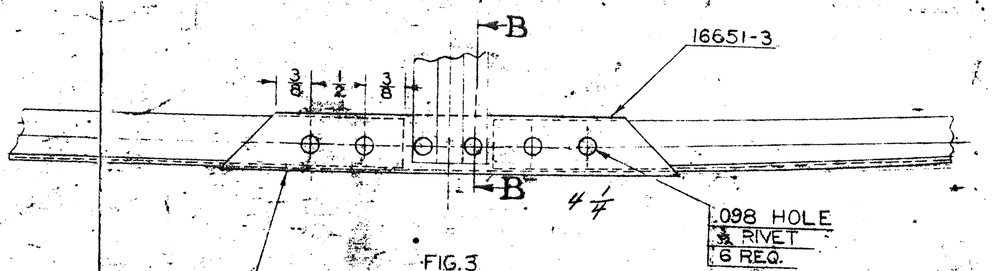

FIG. 3
FULL SIZE

NOTE: FORM REINFORCEMENT OVER CAPSTRIP AND RIVET TO WEB OF CAPSTRIP AS SHOWN.

16661-3		REPAIR SECTI
16661-2		REPAIR SECTI
		3/32" x 3/16 L 25
16651-3		REINFORCE
16651-2		REINFORCE
16621		REPAIR SE
PART NO.	NO. REQ.	

SCALE NOTED — TOT
FINISH—PIPER SPECIFICATION #10
MANUFACTURING PRACTICES—PIPER SP

APR 10 1972

MODEL	PER PLANE	NEXT ASSEMBLY	SUPERSEDES	SUP. BY
J5				
J4				
L-4A		14766		
J3		13004		
		13004-15556		

USC MAT'G 335 REMOVED 11-29-45 DB

PIPER AIRCRAFT CORP. E.L.N. BRETT

RIB REPAIRS
16643

16643